

Fitting Instructions #3358IS

Mitsubishi Lancer

Blade control arm front bush



- The bushes can be replaced without totally removing the blade arm from the vehicle
- Support the vehicle on a hoist and remove the 2 off bolts fixing the blade to the vehicle
- Pull the control down far enough and block in place to gain access to the bushing
- Using suitable press sleeves and threaded rod extract the old bushes.
- Clean up the housing area to remove any old original bushing materials and ensure the bores are smooth and free of burrs;
- Using suitable sleeves and threaded rod pull the new bushing "3588" into place
- Note the bushing should sit central in the housing see Fig 2
- Grease the bore of the bush and using multigrips or similar press crush tubes into the bush. Fig 3
- The tube will click into place when correctly seated
- Using the original bolts removed re attach assembly

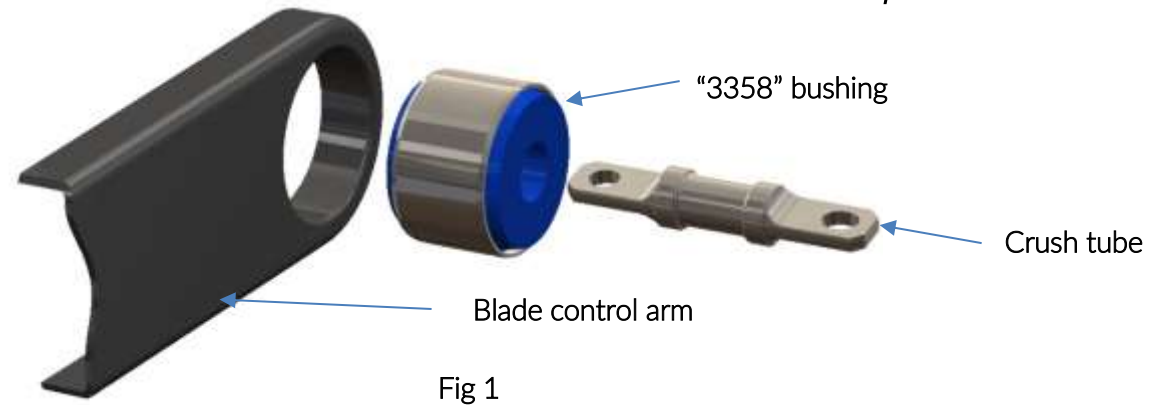


Fig 1

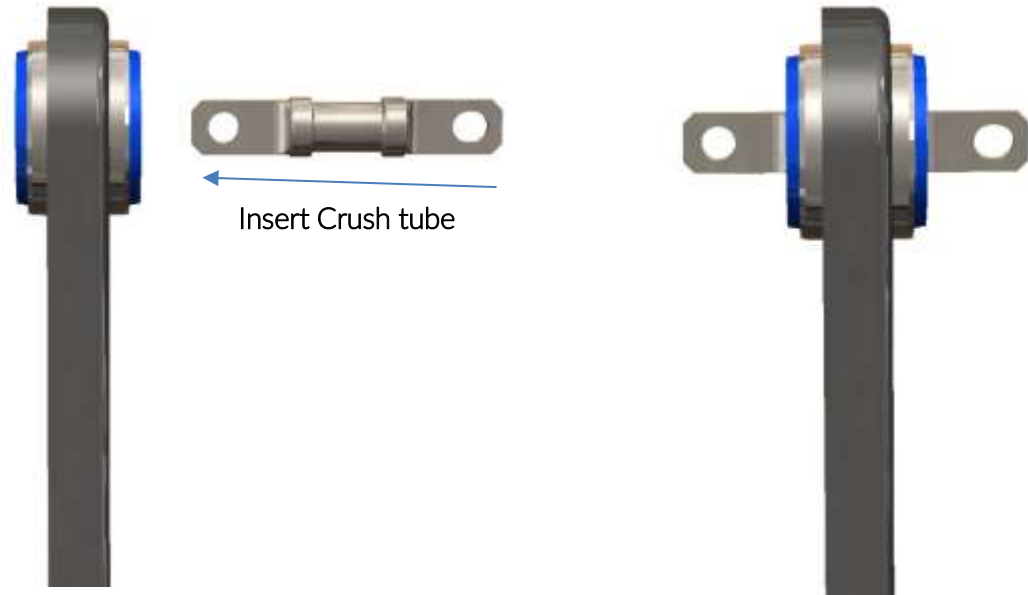


Fig 2

Fig 3 Completed assembly